

Siemens Energy & Automation, Inc.  
 Bellefontaine, Ohio 43311 U.S.A.  
 © Siemens Energy & Automation, Inc. 2000

## Installation Instructions

**⚠ DANGER**

**Hazardous voltage. Will cause death or serious injury.**

Turn off and lock out all power supplying circuit breaker, frame or connect-all before removing cover(s) or device and while cover(s) are removed. Replace the covers and shields before power supplying this device is turned on.

**SAFETY INSTRUCTIONS**

NOTE: This instruction outlines the recommended installation procedure.

Catalog No's. TA5P600, TA4P750

1. Turn off power supplying device before installing.
2. Attach power cable (1) to cable connectors (3) and tighten cable set screws (2) to specified torque listed in table below.
3. Mount solderless cable connectors (3) to mounting block assy's (4) with mounting bolts (5), lockwashers (6) and flatwashers (7) supplied with connector as shown. Torque mounting bolts to 300 in. lbs.

NOTE: Steps 2 and 3 may be completed in reverse order.

The terminals have been tested per UL-486 B with standard stranded cable.

Cat. No.	Wire Range	Torque	
		Set Screw	Mtg. Screw
TA5P600	(1-5) 300 - 400 kcmil. Cu-Al	600 in. lbs.	300 in. lbs.
	(1-5) 500 - 600 kcmil. Cu-Al	780 in. lbs.	
TA4P750	(1-4) 600 - 750 kcmil. Cu-Al	480 in. lbs.	300 in. lbs.

