




# SIEMENS

Item: TA1FD350A  
 For use With: F, FD, FF & FM FRAME CIRCUIT BREAKERS, MOLDED CASE SWITCHES AND MOTOR CIRCUIT INTERRUPTORS.  
 Page 1 of 1  
 Pc. No. 410211A05

Installation Instructions	
	<b>Danger</b> <b>Hazardous Voltage Will cause death or serious injury</b> Turn off and lock out all power supplying this device before working on this device. Replace all covers before power supplying this device is turned on.
	<b>Peligro</b> <b>Tensión peligrosa Puede causar la muerte o lesiones graves</b> Desenergice totalmente antes de instalar o darle servicio. Reemplace todas las barreras y cubiertas antes de energizar el interruptor.
	<b>Danger!</b> <b>Tension dangereuse Danger de mort ou risque de blessures de graves.</b> Couper alimentation de l'appareil et barrer avant de travailler. Remplacez tous les couverts avant que l'alprovisionnement de pouvoir soit alimenté.

NOTE - These instructions do not purport to cover all details or variations in equipment, or to provide for every possible contingency to be met in connection with installation, operation or maintenance. Should further information be desired or should particular problems arise, which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the local Siemens sales office. The contents of this instruction manual shall not become part of or modify any prior or existing agreement, commitment or relationship. The sales contract contains the entire obligation of Siemens. The warranty contained in the contract between the parties is the sole warranty of Siemens. Any statements contained herein do not create new warranties or modify the existing warranty. Trademarks - Unless otherwise noted, all names identified by ® are registered trademarks of Siemens AG or Siemens Industry, Inc. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

This kit contains a solder less connector and associated hardware for making one (1) line or load connection on FD6, FD6-A, HFD6, HHFD6, FXD6,FXD6-A, CFD6, FFC & FFF, FM6, FMK circuit breakers.

1. Turn off and lock out power feeding this circuit breaker before working on circuit breaker.


NOTE: Trip Unit must be installed in breaker prior to mounting load-end connector.

2. Mount connector to breaker terminal with mounting screw.

Torque mounting screw 150 lb-in. [16.95 N-m].

3. Install conductor cable and tighten binding screw securely per table below.

Wire Size	UL 486A-486B Required Wire Stranding		Torque lb-in. [N-m].
	CU/AL	CU	
	Class B	Class C	
6-2 AWG CU/AL	7	19	120 [ 13.56 ]
1 AWG CU/AL	19	37	120 [ 13.56 ]
1/0 - 350 kcmil CU/AL	19	37	275 [ 31.07 ]

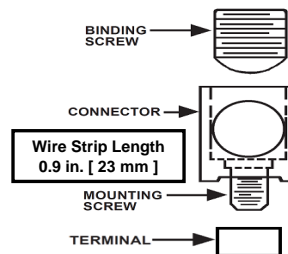

**SIEMENS**  
**TA1FD350A**

---

**WIRE GRIP KIT**

Each kit contains a Solderless Connector and associated hardware for making one (1) Line or Load Connection on F, FD, FF & FM Frame Circuit Breakers, Molded Case Switches & Motor Circuit Interruptors.

---

MCCB Accessory

---

**QTY 1**



---

Siemens SA de CV IBT DIV      Made in México  
Libramiento Arco Vial, Km 4.2 Pte Edif C, 66350 Santa Catarina, NL, México